

1 Railroad- Can be excluded, no train tracks run through the area.

2
3 Fireworks- Can be excluded, no reports of fireworks in the area.

4
5 Playing with Fire- Can be excluded, the area is isolated and secured behind locked gate.

6 Neighbors stated they are very diligent about watching the area, due to the fire threat. No
7 children have been seen in the area for months.

8
9 Power lines- Cannot exclude power lines, there have been three fires in the area over the past
10 couple years. Per interviewed neighbors, each fire occurred during high wind events and were
11 caused by arching powerlines that run through this area. Additionally, interviews with employees
12 from the Water Treatment Plant stated, they had a large wind event come through prior to the fire
13 start, within in minutes of the wind event, the Treatment facility lost power and switched over to
14 generator power. Also, Edison admitted to having a fault from "phase to ground" occurred on the
15 circuit running behind the Roadrunner Ave. addresses. Further physical evidence discovered,
16 showed damaged lines over the SOA and damaged communication lines that may have
17 interacted with the high voltage lines, causing a probable ignition source.

18 Glass refraction- Can be excluded, I found several pieces of broken glass in the area. However,
19 the glass segments were not located within the burn area.

20
21 Incendiary- Can be excluded, the area is open view to the houses that back up to where the fire
22 occurred. All neighbors interviewed did not report seeing any one in the area during the time this
23 fire occurred. Considering the access point is a single locked gate, and the only other way out is
24 through open wild land, first arriving helicopters would have located anyone still in the area. In
25 addition, a thorough search of the area did not produce any evidence that would indicate a hiking
26 or recreational area.
27
28
29
30
31
32
33